

CHECK GLENAIR WEBSITE FOR LATEST REVISION

AI85097-03

Revision History

Rev	Date	Initiated By	Approved
A	12/20/22	WLL	GH

Tools needed:

- M22520/2-01 AFM8 w/K1906 Crimper & Positioner
- 600-235 & 600-236 Alignment Tool
- 600-242 Insert Tool

Twisted Pair Color Orientation of Cable



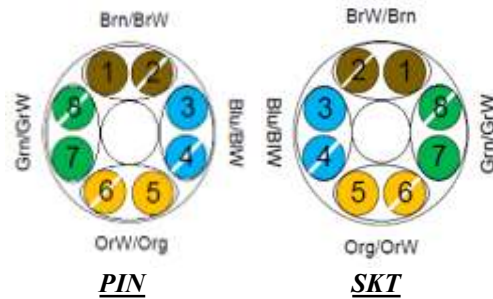


Figure 1

Cable Layout for Pin Contact 858-005-03

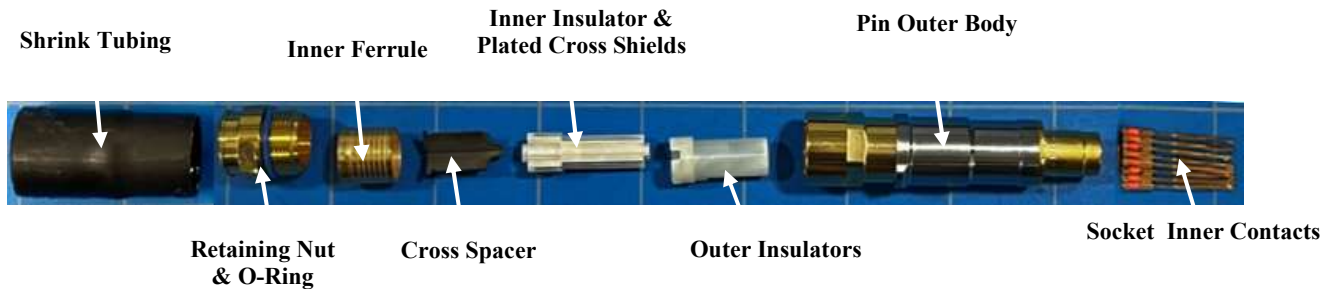

Cable Layout for Socket Contact 858-006-03

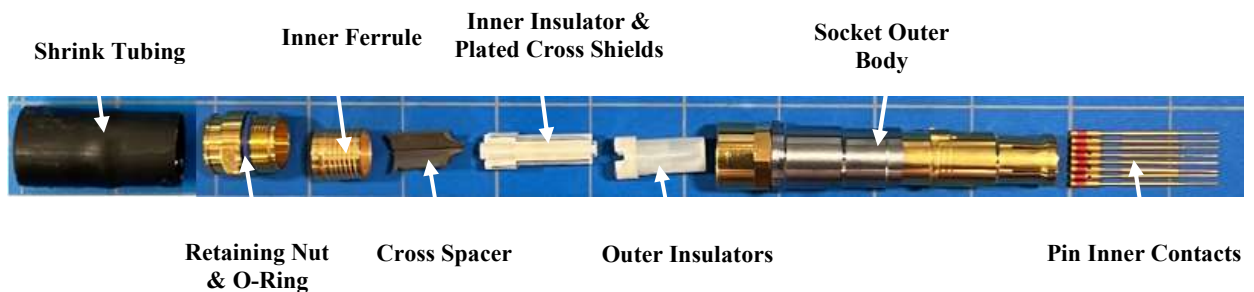


CHECK GLENAIR WEBSITE FOR LATEST REVISION

Procedure

Step 1:

For **858-005-03** remove cable jacket (1.15") to expose the braid shield. For **858-006-03** remove cable jacket (1.25") to expose the braid shield.

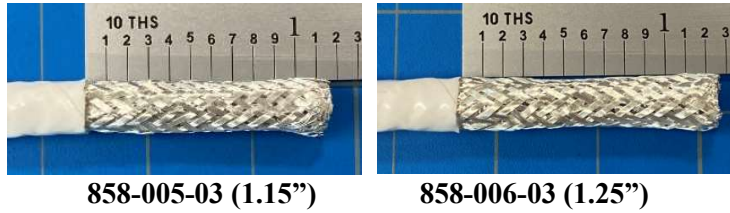

Step 2:

Flare, fold, and comb braid straight. Remove foil, wrap, and spline.



Step 3:

Identify cable twisted pair color orientation to match **Figure 1** for Pin or Socket contacts. Remove insulation of the conductors to (0.115"). Install inner contacts (8X) over conductor until fully seated. Make sure the conductor is visible through the inspection hole. Crimp the inner contacts using crimp tool **M22520/2-01** and positioner **Daniels P/N K1906**, Setting #4 for 24 AWG.



Step 4:

Slide the 'Retaining Nut' and 'Inner Ferrule' over the braid shield. Fold braid over ferrule but **do not trim**. Insert cross spacer between pairs.




CHECK GLENAIR WEBSITE FOR LATEST REVISION

Step 5:

Slide the inner insulator (with cross shields) into middle of inner contacts. Pay attention to the orientation of the wires. Snap the contacts in place of the insulator slot cavities.

Note: The twisted pairs are essentially parallel to the axis of the bundle with no crossover.

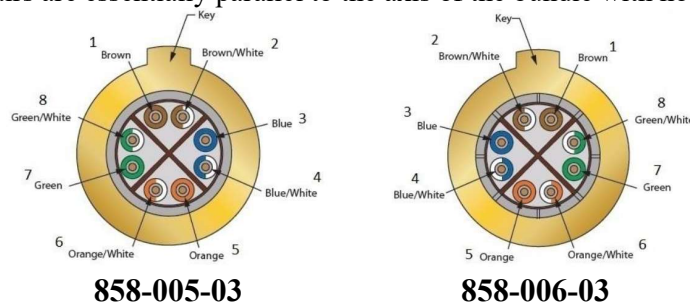

Step 6:

Slide outer insulator over inner insulator. Push the outer insulator in until outer and inner tabs nest together. Verify the key is in the right orientation per **Step 5**. Slide the 'Retaining Nut' and 'Inner Ferrule' up until the cross spacer contacts the inner insulator. Trim braid at ferrule knuckle.



Step 7:

Install outer shell body (858-005-03) in tool 600-236 or (858-006-03) in tool 600-235. Ensure the male polarization key of the shell is engaged into the female key locator on the tool. Ensure the polarization key of the outer insulator is lined up with the polarization key of the shell body per **Figure 2**. Use insert tool 600-242 to slide cable assembly into shell body using 600-235 or 600-236 as a guide per **Figure 3**. Ensure the assembly is fully inserted in the body. Use adjustable wrench to tighten 'Retaining Nut' in outer shell body slightly more than hand tight per **Figure 4**. Remove body and finish torquing to 5-8 inch-lbs.

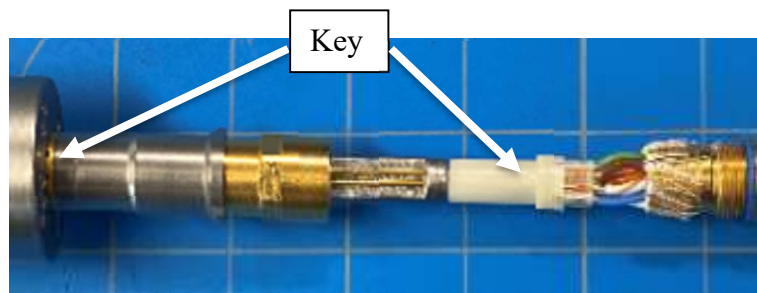


Figure 2




Figure 3

Figure 4


CHECK GLENAIR WEBSITE FOR LATEST REVISION

Step 8:

For **858-005-03** ensure insulator face is $+0.005$ "/ -0.006 " away from outer contact face. For **858-006-03** ensure inner contacts are -0.018 "/ -0.044 " away from outer contact face.

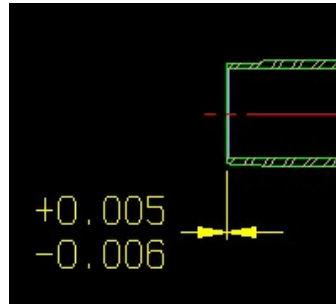

858-005-03

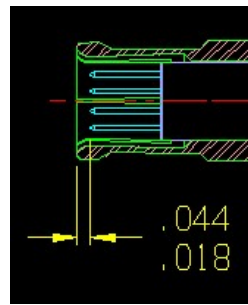

858-006-03

Step 9: "When applicable"

Slide heat shrink tubing over outer body contact. Shrink tubing just below the retaining nut thread seam.

